Poptávka

SNÍMAČE TEPLOTY TR34

Série TR34

TR34-14115539
Snimač teploty M12x1 -30-150°C PT100 G1/4 50x6mm
ATEX



- Výstup 4-20mA
- Teplota -30 až 250°C
- Připojení G, NPT
- Média voda, plyny, oleje
- ATEX, IECEx


POPIS PRODUKTU

SPECIFIKACE

Insertion length	50 mm
Materiál kontaktní části	Nerez ocel
Materiál těla	Nerez ocel
Napájecí napětí DC max.	30 V DC
Napájecí napětí DC min.	10 V DC
Plug diameter	6 mm
Připojení	G1/4
Provozní teplota max.	150 °C
Provozní teplota min.	-30 °C
Shoda s normami	ATEX
Teplota okolí do	85 °C
Teplota okolí od	-40 °C
Třída krytí	IP67

Dimensions in mm


Process connection with parallel threads (or without process connection)

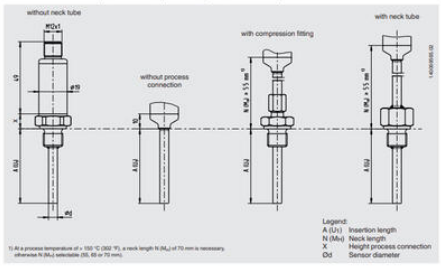

1) At a process temperature of > 150 °C (302 °F), a neck length N (M_6) of 70 mm is necessary, otherwise N (M_6) selectable (55, 65 or 70 mm).

Thread	Height process connection X
G ½	11
G ¾	11
G ¼	10
M12	11
M20	11

Process connection with tapered thread

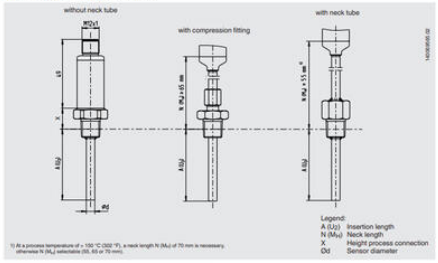

1) At a process temperature of > 150 °C (302 °F), a neck length N (M_6) of 70 mm is necessary, otherwise N (M_6) selectable (55, 65 or 70 mm).

Thread	Height process connection X
¼ NPT	15
½ NPT	19


Electrical connection

Output signal 4 ... 20 mA
M12 x 1, 4-pin circular connector



Pin	Signal	Description
1	L+	10 ... 30 V
2	VQ	not connected
3	L-	0 V
4	C	not connected

Output signal Pt100 or Pt1000 sensor
M12 x 1, 4-pin circular connector

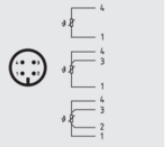


Configuration software WIKAsoft-TT



Dimensions in mm


Process connection with parallel threads (or without process connection)

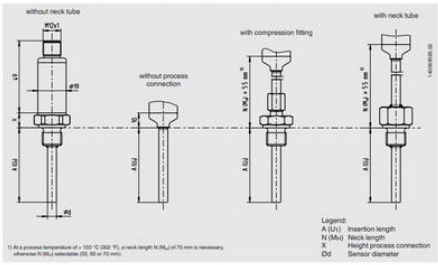

1) At a process temperature of > 150 °C (302 °F), a neck length N (M_6) of 70 mm is necessary, otherwise N (M_6) selectable (55, 65 or 70 mm).

Thread	Height process connection X
G ½	11
G ¾	11
G ¼	10
M12	11
M20	11

Process connection with tapered thread

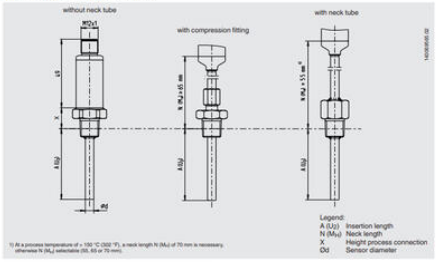


1) At a process temperature of > 150 °C (302 °F), a neck length N (M_6) of 70 mm is necessary, otherwise N (M_6) selectable (55, 65 or 70 mm).

Thread	Height process connection X
¼ NPT	15
½ NPT	19


Electrical connection

Output signal 4 ... 20 mA
M12 x 1, 4-pin circular connector



Pin	Signal	Description
1	L+	10 ... 30 V
2	VQ	not connected
3	L-	0 V
4	C	not connected

Output signal Pt100 or Pt1000 sensor
M12 x 1, 4-pin circular connector

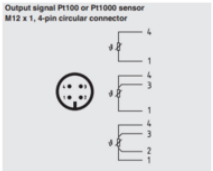

Configuration software WIKAsoft-TT

